
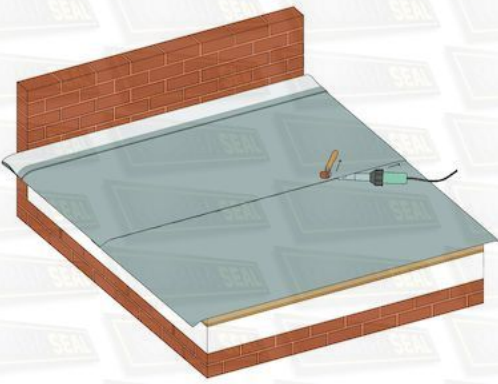
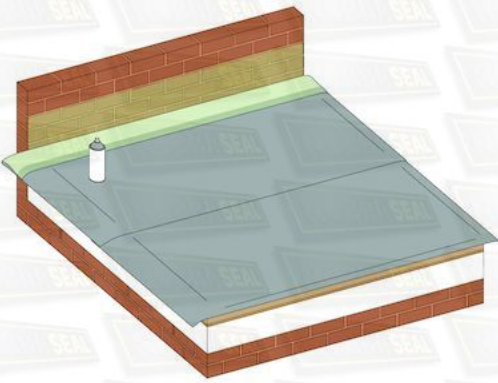



Laying Lineflex With Mechanical Fixings

A guide to laying Lineflex Fleece Backed EPDM membrane with mechanical fixings.

	<p>Step 1 Fix the first section in place using fixings and washers @ 300mm centres.</p>
	<p>Step 2 Overlap next section of membrane beyond washers by a minimum of 50mm and seal with hot air welder using a silicone roller at a rate of 2.5m per minute at 220 degrees (level 4).</p>
	<p>Step 3 Where applicable, use solvent-based adhesive to adhere to any upstands.</p>
	<p>Step 4 Install washers and fixings 40mm from upstand, 300mm apart.</p>



Step 5
Apply primer over the fixings.



Step 6
Seal with 6" cover tape.